

LAND CORNER RECORD

Index: V-17	Corner: Common Corner between Sections 26, 27, 34 and 35	State of Indiana - Hoosier National Forest
Section: 27	Township: 7N Range: 1E P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1369152.454 Long./E: 3150506.719	Datum: NAD83 IN West Zone, US Survey Feet


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
9/15/1982	Ken Anderson L.S. #80040545	A stamped 3" aluminum monument set	USDA Forest Service Bedford, IN	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
* = stump hole in 2018	Hickory	12"	S76°W	25.44'
	Beech*	14"	N68°E	23.41'
	Hickory*	7"	S21°W	24.57'
Record evidence of prior survey:	All bearing trees were gone in 2018.			
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
4/7/2009	Kevin Enright Monroe County Surveyor	Metal post with "LAND SURVEY MONUMENT" sign found	Monroe County Surveyor's Office Bk. 41, Pg. 74	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
NOTE: These reference objects are recorded to witness post, not the monument.	Sugar Maple	9"	N78°W	24.70'
	Sugar Maple	17"	N51°W	43.10'
	White Oak	32"	N18°E	21.16'
Record evidence of prior survey:	Robert Stone's Certified Land Corner Restoration says that a 30" long concrete filled, 2-1/2" diameter aluminum pipe with a 3" aluminum cap with a rock cairne at the base was set.			

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
** = no paint * = previous bearing tree, from 2009, new blaze	Sugar Maple* **	9"	N90°W	26.59'
	Sugar Maple**	14"	N55°W	42.61'
	White Oak* **	30"	N25°E	18.34'
	Sugar Maple**	14"	S35°E	50.78'
Monument Found or Set:	A 3" aluminum monument stamped "U.S.D.A. FOREST SERVICE UNLAWFUL TO DISTURB" was reset 1.2' above grade (hit rock) using previous bearing trees.			


MONUMENT SKETCH

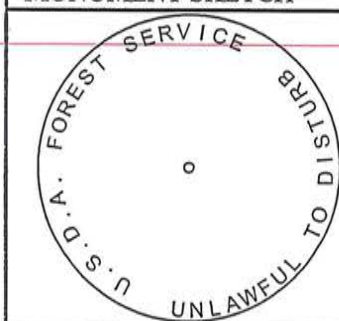

NARRATIVE REFERENCE:

Monument is a 3" aluminum monument stamped "U.S.D.A. FOREST SERVICE UNLAWFUL TO DISTURB" which was reset 1.2' above grade (hit rock) using previous bearing trees stump holes from 1982 Land Corner Record, a carsonite post is located 4.2' S70°W of the monument, located 2' west of a meandering drainage, in an area that had been washed out, +/- 20' north of a steep bank, a mound area to the east is approximately 4' higher than the monument, a Pine stand is to the east on top of a ridge top heading back to St. Rd. 446, a rock cairn was placed at the base of the monument.

SECTION DIAGRAM

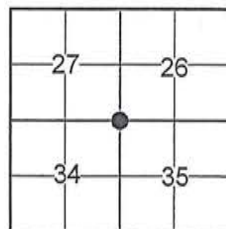

Corner Location = ●

PERPETUATION RECORD:

The record monument was found washed out and recovered downstream. The monument was reset by its prior 1982 Land Corner Record and maintained by remarking three existing bearing trees and establishing one new bearing tree. Three existing bearing trees were recovered from a Monument Record by Kevin Enright, dated 4/7/2009, referencing the 1982 witness post (monument was washed out prior to 2009).

Four bearing trees were marked with a blaze, scribed B.T., bearing tree sign and mag nail.

Referenced on BRCJ survey recorded as InstNo.2018007752

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 27 T7N R1E

Prepared By: BRCJ

(Project#3-0822)

Date: 5/2018

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 26

Township: 7 North


Range: 1 East

Corner ID: Polk Q-21

Monument Description & Remarks: Metal Fence Post with sign, "LAND SURVEY MONUMENT". Survey Sign 3ft at pt. A

References On File: Kent Anderson survey notes (1983) on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 41 Page No. 74

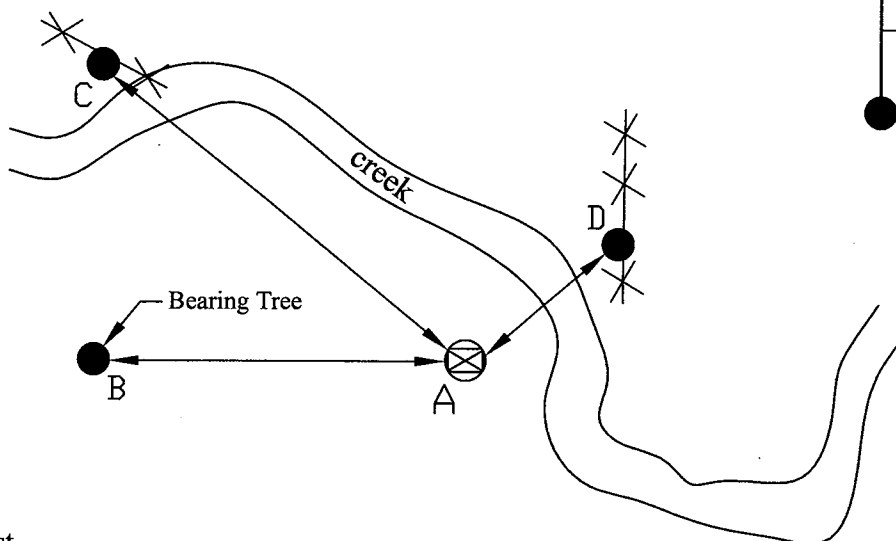

- A - Metal Fence Post
- B - N 78° W 24.70' to MAG
nail in 9" Sugar Maple
- C - N 51° W 43.10' to MAG
nail in 17" Sugar Maple
- D - N 18° E 21.16' to MAG
nail in 32" White Oak


Not To Scale
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 28th day of October, 2008.

Kevin Enright

Administered by the Monroe County Surveyor Review Board

Date: 4-7-2009

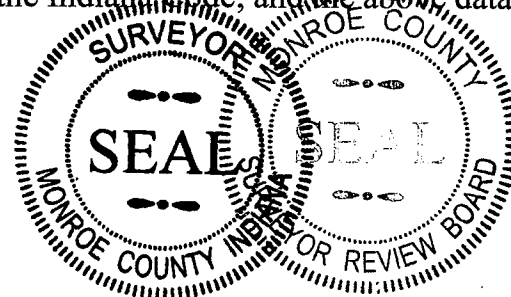

Index No. V-17
(Alphabetical - Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)
GPO 806-924

T. 7N R. 1E Mer. N.F. Hoosier County Mo. State Ind
Section Corner common to sections 26, 27, 34 and 35

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed <u>1854</u>		Year of search _____	By _____
Original monument <u>Wood Post</u> (Wood post, stone, pile of stones, pipe, etc.)		Monument found _____	
Bearing Trees Species <u>W. Walnut</u> <u>S 55° E</u> Diameter <u>8"</u> <u>6"</u> Bearing <u>SSE</u> <u>S 53° W</u> Distance <u>11 lbs</u> <u>21 lbs</u>		Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____	
Subsequent Corner Restoration Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc.)		Evidence of Subsequent Corner Restoration Found Year of search _____ By _____ _____ _____ _____	
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____		Bearing Trees, Reference Objects _____ _____ _____ _____	



Sketch

○ Corner ☒ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____

Object _____

Record distance _____

Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

At time of search:

1. Did you have the record description?
Yes _____ No _____

2. How was search area located?
Pacing, chaining, photos, maps,
etc. _____

3. Man hours spent in search _____

4. Do you think additional search might
recover evidence? Yes _____ No _____

5. Signature _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____